Models Affected: Linea - ALL FB-70 - ALL




## **TECHNICAL BULLETIN #34**

December 16, 2003

## Antidisturbance Filter

CAUTION: Prior to performing this procedure, ensure power to the espresso machine has been disconnected at the source. This procedure must be done by a certified technician.

La Marzocco has discovered that in certain installations, the La Marzocco espresso machine can create electrical disturbance in the radio frequency bandwidth. This may be resolved by adding a capacitance/resistance anti-disturbance filter (p/n L201 Electromagnetic Compatibility Filter, 470N+100R). The filter must be installed in parallel with the coil of the contactor switching the steam boiler heating element. This can be accomplished either by installing the filter directly on the contactor or by installing the filter on the main electrical terminal block.

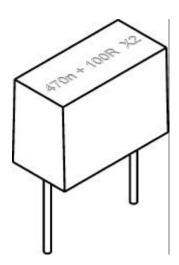

P/N L201 Electromagnetic Compatibility Filter, 470N+100R